




Meizu MX3 Headphone Jack Replacement

This guide shows how to replace the Headphone Jack in the 5.1 inch Meizu MX3.

Written By: Mandela Robin

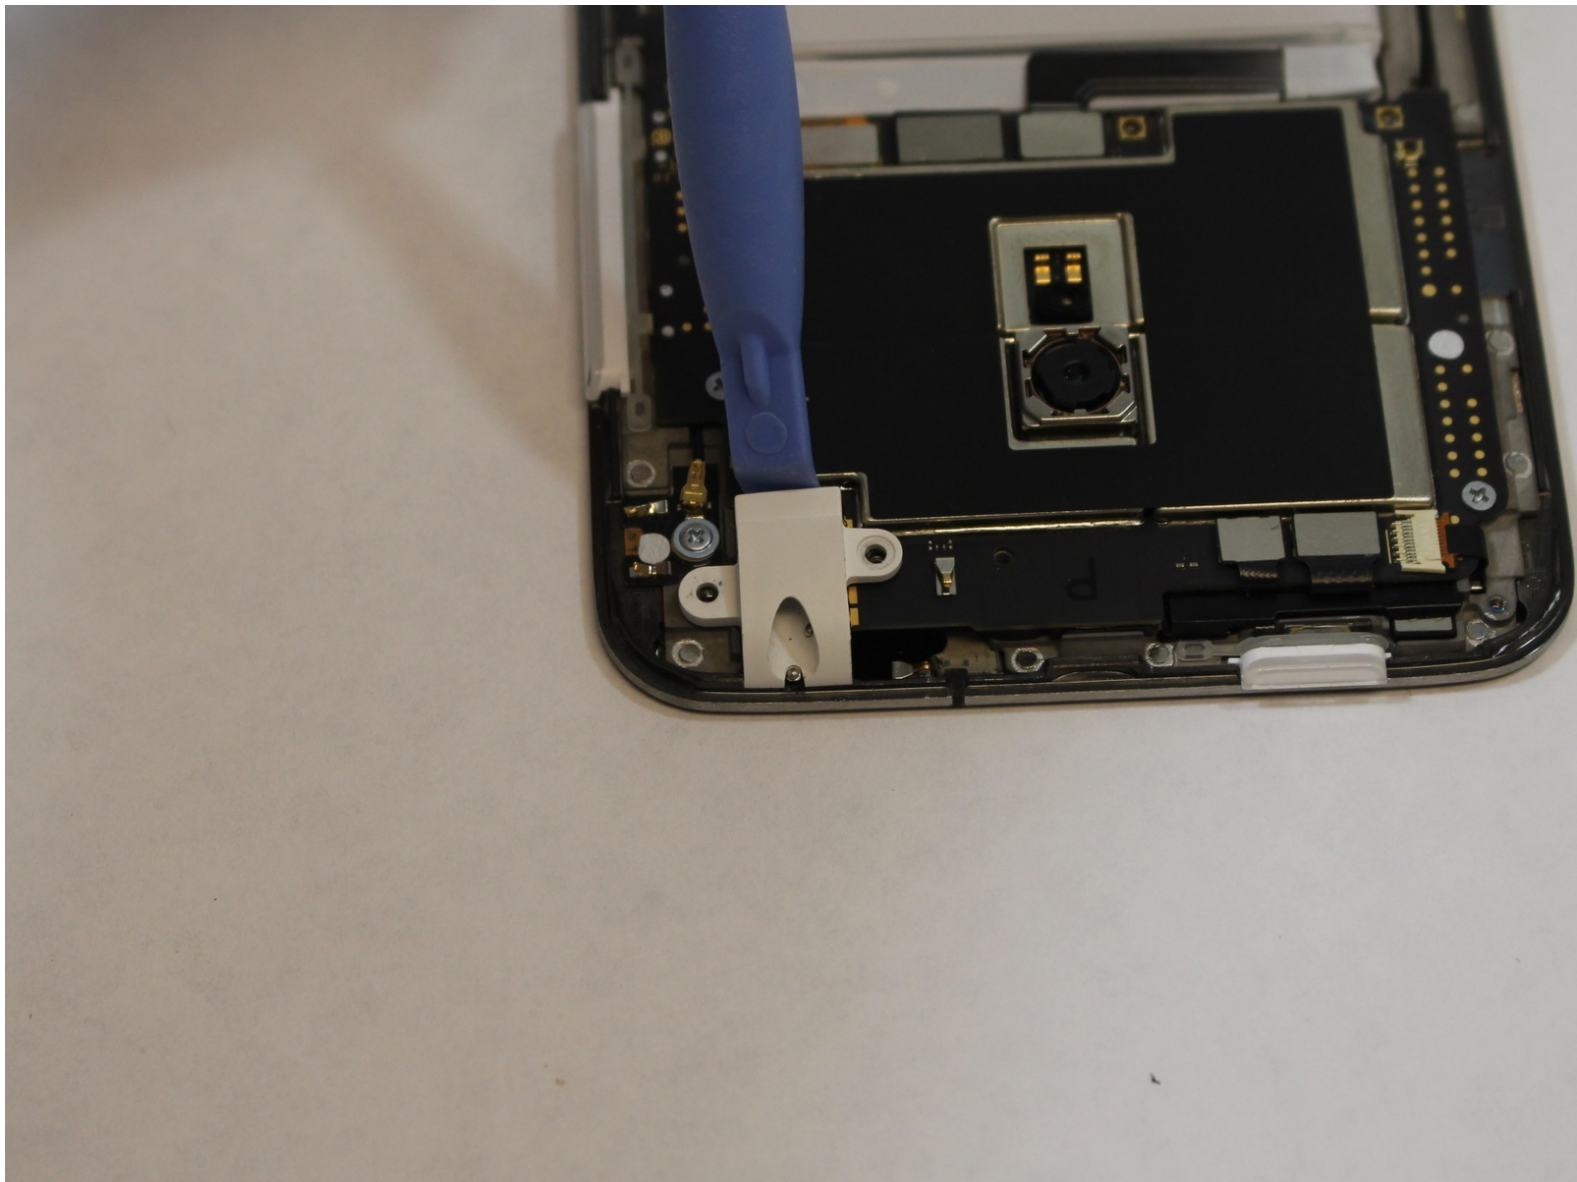

INTRODUCTION

If your headphones aren't working, and you're sure that it is not a software problem or a problem with your headphones, then you may need to replace the headphone jack in your phone. Luckily, there is no heavy-duty work involved. Follow this guide to learn how to replace your Meizu MX3's headphone jack by simply removing a few screws.



TOOLS:

- [iFixit Opening Tools](#) (1)
 - [Spudger](#) (1)
 - [64 Bit Driver Kit](#) (1)
-

Step 1 — Removing the Back Cover




- Insert the plastic opening tool in between the charging port and the back case of the device. Slowly move the tool to the left of the until you come the top by the power button.
- Using a paper clip or pointed edge spudger push in the pin located in the bottom right had corner of the back of the phone.

Step 2 — Removing the Screws in the Internal Casing




- Using one of the small Phillips screwdriver bits provided unscrew the 11 screws present on the protective plastic plate under the device case.

Step 3 — Removing the Battery

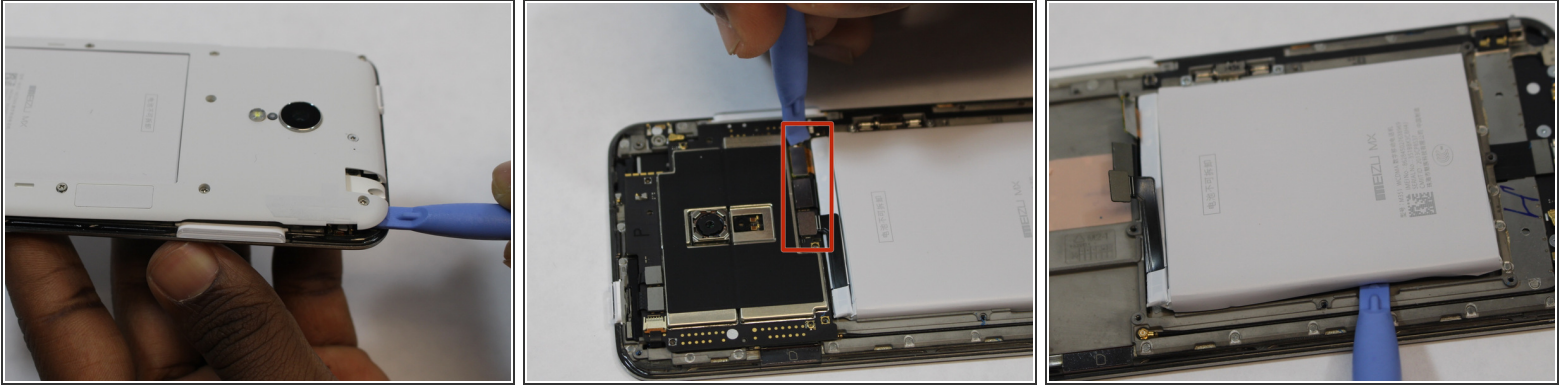

- After the 11 screws are loosened use the plastic opening tool and gently pry the protective plate from the back of the device.
- Once the plate is off, use the same tool to gently remove the 3 ribbon cables located directly above the battery.
- On the left side of the battery on the phone case, there is a groove where the plastic opening tool can be inserted to pry the battery up and out. The battery might be glued to the phone so exercise caution.

Step 4 — Removing the Headphone Jack

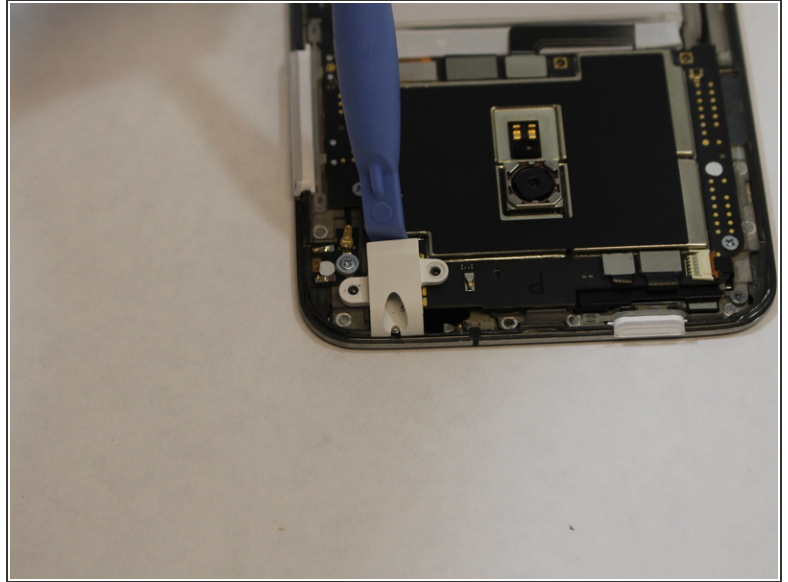

- To finish removing the headphone jack the screw in the purple circle fastening the headphone jack to the motherboard will need to be removed.
- Once slackened, the headphone jack can be pried up using the plastic opening tool, as seen in the picture.

To reassemble your device, follow these instructions in reverse order.

This document was last generated on 2017-11-13 12:41:19 AM.